



GE
Industrial Solutions
41 Woodford Avenue
Plainville, CT 06062

Owner Notification Letter

Important Safety Recall Notice

Dear Customer:

This letter is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

GE has decided that a defect which relates to motor vehicle safety exists in certain Midwest 30 Amp, 125V receptacles used in Recreation Vehicle Power Outlets/Pedestals.

!IMPORTANT!

- Certain Midwest 30 Amp, 125V Receptacles used in Recreation Vehicle Power Outlets/Pedestals, which may bear the brand Midwest, GE or Heritage are being recalled
- You should quarantine material that is not in service and immediately, if possible, stop using material that is already in service. Contact GE at 1-866-855-8504 to arrange for replacements and return of the affected products.

Why is a recall being conducted?

GE is initiating a voluntary recall of certain Midwest 30 amp, 125V receptacles manufactured between May 21, 2012 and July 20, 2012 due to a potential manufacturing irregularity in a formed metal component used in the receptacles. The affected component, referred to as the "ground clip", is located behind the receptacle's plastic face plate as shown in Figure 1.



Figure 1 - Midwest 30 Amp, 125V Receptacle (Ground Clip location circled in RED)

The air gap between the two outer edges of the ground clip may be oversized resulting in an incomplete electrical ground connection, which may expose users to a risk of shock under certain conditions.

Midwest Brand 30A, 125V Receptacle Replacement Part Catalog Numbers

R32U	BR32U	PR32U	
------	-------	-------	--

Midwest Brand RV Power Outlet/Pedestal Catalog Numbers

M031C010	U013CP	U041GTL	U131CP6010
M041C010	U013F	U058C	U131CTL010
M041C010U	U013P	U058CP6	U132CTL
M041CB6010	U031C010	U061C	U175CP6HP010
M041CP6010	U040G	U061CP6	U412CP6010
M041GP6	U040GTL	U061CTL	U412G
M075C010	U041	U075C	U611CB6010
M075C010UFMG	U041010	U075CB6010	U611CP6010
M075CB6010	U041C	U075CP4010	U611CTL010
M075CP4010	U041C010	U075CP4L31	U614C
M075CP6010	U041CB6010	U075CP6010	U775C010
M075CP6010FMG	U041CB6L10	U075CP6010D	VKKJHAAT
M075CP6L39	U041CP	U075CP6031	VKKJHCQT
M775CP6010	U041CP4010	U075CP6039	VOKJHAAT
R041C010	U041CP6010	U075CP6L10	VOKJHCQT
R041CP6010	U041CP6039	U075CP6L31	VPKJHAAT
R058C	U041CP6L10	U075CTL010	VPKJHAUT
R075C010	U041CTL010	U075CTL035	VPKJHCQT
R075CB6010	U041F	U075CTLL10	VQJJHAAJJHAAT
R075CP6010	U041G	U075GB6	VWKJHCQW
R075GP6	U041GP	U075GP4	
U013	U041GP4	U075GP6	
U013C	U041GP6	U075GTL	

GE Brand RV Power Outlet/Pedestal Catalog Numbers

GE1LU032SS	GE1LU532ES		
------------	------------	--	--

Heritage Brand RV Power Outlet/Pedestal Catalog Numbers

H41B3	H60SM3	H75B3	MH41SM3
H41P5	H61B3	H75P3	MH75B3
H41SM3	H61P3	H75SM3	MH75P3
H58SM3	H61SM3	MH41P3	MH75SM3

List of affected products containing a Midwest 30 Amp, 125V Receptacle

Midwest 30 Amp/125V Receptacle

Used in Recreation Vehicle Power Outlets/Pedestals

Manufacturing Date Codes affected: L2xx! (where xx can equal 21 to 29)

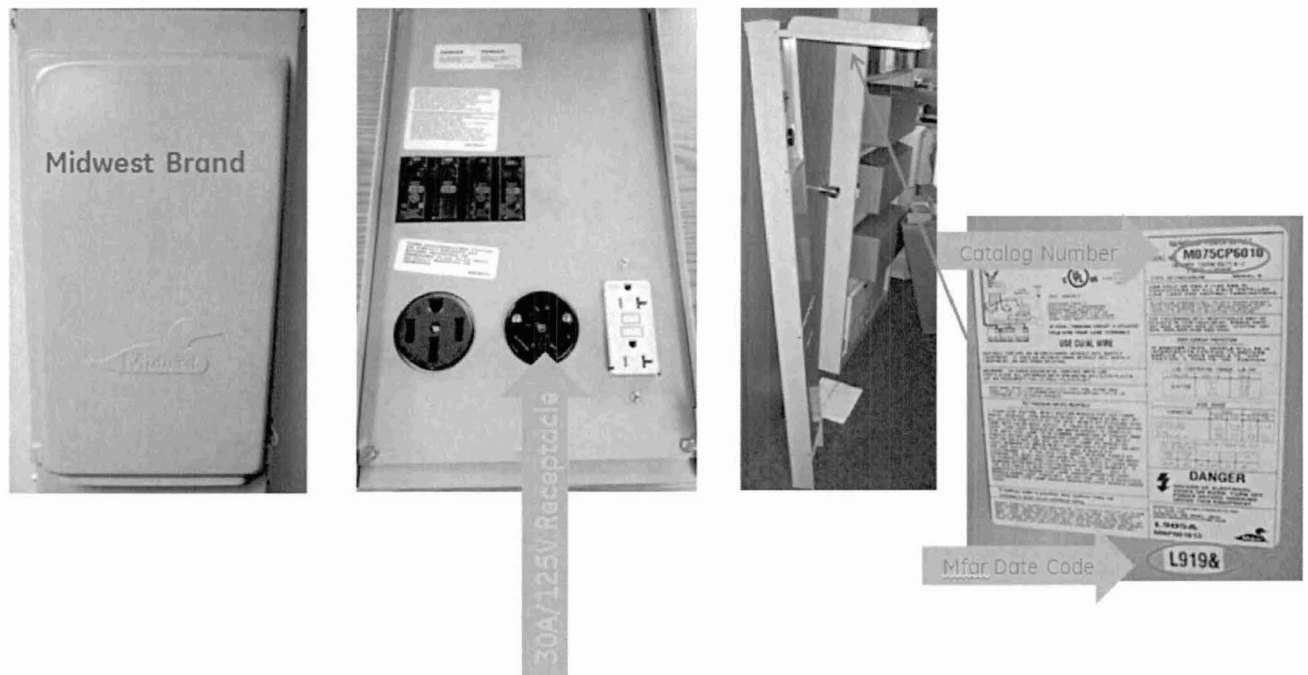


Figure 4 - Midwest RV Power Outlet/Pedestal Catalog Number & Mfg Date Code