SAFETY RECALL NOTICE

Philips Lighting Company Announces Recall of 12W EnduraLED lamp manufactured in November 2012 (date code "2"L) and 12.5W AmbientLED lamp manufactured in October 2012 ("2K") and November 2012 ("2L") with a factory code "S"






Factory Mark – slanted "S"



Date Code – "2K" or "2L"



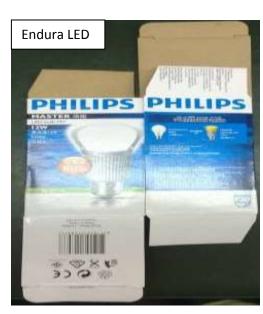

Shock Hazard: Philips has identified a shock hazard with these products involving the power resistor lead wire. This can potentially lead to an improper fit of the lead wire in the lamp housing, such that the lead wire can come into physical contact with the lamp housing, which in turn can cause the housing to electrify at a measured voltage of up to 82Vrms.

Recalled Products:

Sold Between October 2012 and May 2013

			•		
Product Description	Model Number	Ordering Code	UPC	Factory Code	Date Code
EnduraLED 12W A19 2700k Dimmable 120V	9290001829	12A19/END/2700-800 DIM	46677 40994	5	2L
AmbientLED 12.5W A19 2700k Dimmable 120V	9290001829	BC-12.5A19/AMB/2700- 800 DIM	46677 42215	5	2K and 2L

Remedy: Consumers/end-users should stop using these products immediately and contact Philips Lighting Company for a free replacement.

For more information: 800-295-5147

Monday through Friday 9:00am to 5:00pm ET Email: ledprincelamp@philips.com
Website: www.philips.com/recall

This recall is being conducted in cooperation with the U.S. Consumer Product Safety Commission.

Post until December, 2013